&Photo D D



SECI-05 Head of Tonsina Bay looking west.



Free-oil Containment and Recovery, Shallow Water



Exclusion Booming




Calm-water Boom



SECI-05-02b Tonsina Bay Stream looking northwest.

Tonsina Bay, SECI-05

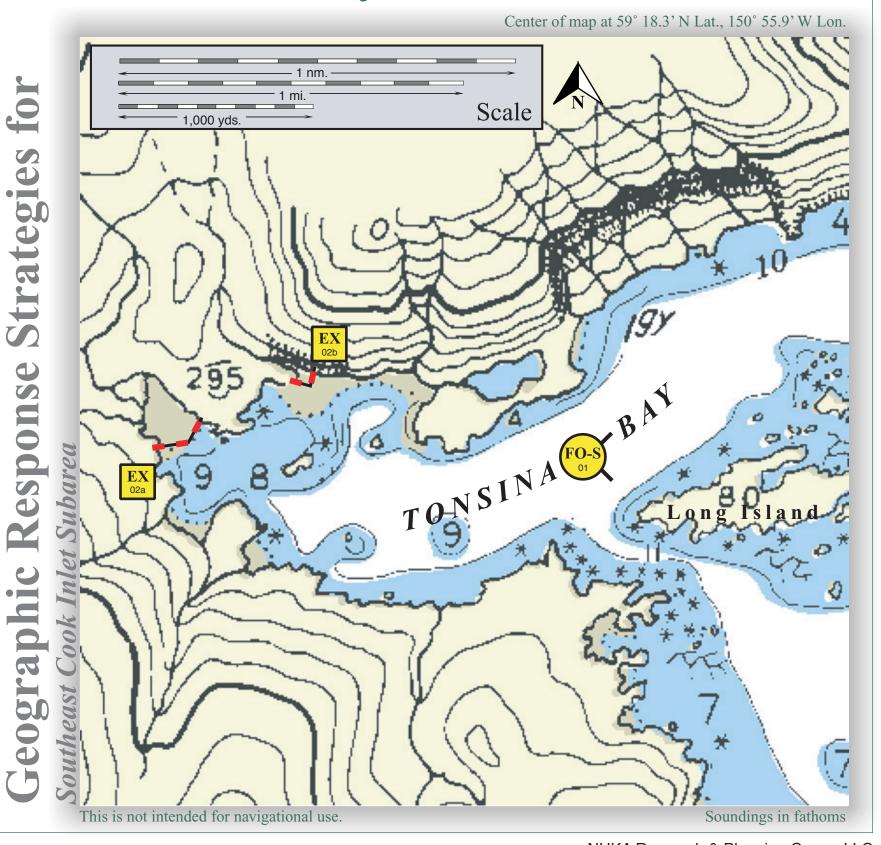

ID	Location and Description	Response Strategy	Implementation	Response Resources	Staging Area	Site Access	Resources Protected (months)	Special Considerations
SECI-05-01	Tonsina Bay Nearshore waters in the general area of: Lat. 59° 18.4 N Lon. 150°55.1 W	Free-oil Recovery Maximize free-oil recovery in the offshore & nearshore environment of Tonsina Bay depending on spill location and trajectory.	Deploy free-oil recovery strike teams upwind and up current of Tonsina Bay. Use aerial surveillance to locate incoming slicks.	Deploy multiple free-oil recovery strike teams as required to maximize interception of oil before it impacts sensitive areas.	Homer/Seward	Via marine waters Chart 16681-1	Same as SECI-05-02	Vessel master should have local knowledge. Use extreme caution, shoal waters with numerous reefs and rocks.
SECI-05-02	Tonsina Bay a. Lat. 59° 18.49N Lon. 150° 36.93W b. Lat. 59° 18.62N Lon. 150° 56.28W	Exclude oil from impacting the identified streams and intertidal area in Tonsina Bay.	Deploy anchors and boom with skiffs (class 6). Place calm-water boom at identified locations in chevron patterns to exclude oil from impacting the intertidal areas and streams. Tend throughout the tide. Boom Lengths: a. 900 ft. b. 600 ft.	Deployment Equipment 1500 ft. calm-water boom 14 ea. small anchor systems 8 ea. anchor stakes Vessels 1 ea. class 3/4 1 ea. class 6 Personnel/Shift 5 ea. vessel crew Tending Vessels 1 ea. class 3/4 1 ea. class 6 Personnel/Shift 3 ea. vessel crew	Vessel platform	Via marine waters Chart 16681-1	Fish- intertidal spawning- salmon (May-Sept.), herring (April-May) Birds-waterfowl concentration, eagle nesting Marine mammals- seals, otters Habitat- marsh, sheltered rocky shoreline High recreational use-anchorage (May–Sept.)	Vessel master should have local knowledge. REPORT any cultural resources found during operations to FOSC Historic Properties Specialist. Site surveyed: 6/07/04 SECI GRS Tactics Committee. Title 41 permitting required from ADNR. Tested: not yet